IBM PS/2 2.3GB Full-High SCSI Tape HML

FRONT

PICTURE 1

September 25, 1990

This pamphlet contains a Symptom-to-FRU Index and a parts listing for the IBM Personal System/2 2.3GB Full High SCSI Tape Drive. It also contains procedures for isolating problems to a FRU.

This pamphlet is intended to be used with the IBM Personal System/2 $\it Hardware\ Maintenance\ Reference\ manual\ (part\ number\ 15F2190)$ and the IBM Personal System/2 $\it Hardware\ Maintenance\ Service\ manual\ (part\ number\ 15F2200)$.

Part Number 84F9803 Form Number S84F-9803-00

IBM PS/2 2.3GB Full-High SCSI Tape HML Safety Information

FRONT_1 Safety Information

Refer to the Hardware Maintenance Service General Information pamphlet for the following information:

General Safety

Floatrical Sefety

Electrical Safety Safety Inspection Guide.

First Edition (September 1990)

The following paragraph does not apply to the United Kingdom or any country where such provisions are inconsistent with local law:

INTERNATIONAL BUSINESS MACHINES CORPORATION PROVIDES THIS PUBLICATION "AS IS" WITHOUT WARRANTY OF ANY KIND, EITHER EXPRESS OR IMPLIED, INCLUDING, BUT NOT LIMITED TO, THE IMPLIED WARRANTIES OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE. Some states do not allow disclaimer of express or implied warranties in certain transactions, therefore, this statement may not apply to you.

This publication could include technical inaccuracies or typographical errors. Changes are periodically made to the information herein; these changes will be incorporated in new editions of the publication. IBM may make improvements and/or changes in the product(s) and/or the program(s) described in this publication at any time.

It is possible that this publication may contain reference to, or information about, IBM products (machines and programs), programming, or services that are not announced in your country. Such references or information must not be construed to mean that IBM intends to announce such IBM products, programming, or services in your country.

Requests for technical information about IBM products should be made to your IBM Authorized Dealer or your IBM Marketing Representative.

IBM may have patents or pending patent applications covering subject matter in this document. The furnishing of this document does not give you any license to these patents. You can send license inquiries, in writing, to the IBM Director of Commercial Relations, IBM Corporation, Armonk NY 10504.

| Copyright International Business Machines Corporation 1990. All rights reserved.

Note to U.S. Government users-Documentation related to Restricted rights-Use, duplication, or disclosure is subject to restrictions set forth in GSA ADP Schedule Contract with IBM Corp.

IBM PS/2 2.3GB Full-High SCSI Tape HML Special Notices

FRONT_2 Special Notices

References in this publication to IBM products, programs, or services do not imply that IBM intends to make these available in all countries in which IBM operates. Any reference to an IBM product, program or service is not intended to state or imply that only IBM's product, program, or service may be used. Any functionally equivalent product, program, or service that does not infringe any of IBM's intellectual property rights or other legally protectible rights may be used instead of the IBM product, program, or service. Evaluation and verification of operation in conjunction with other products, programs, or services, except those expressly designated by IBM, are the user's responsibility.

IBM may have patents or pending patent applications covering subject matter in this document. The furnishing of this document does not give you any license to these patents. You can send license inquiries, in writing, to the IBM Director of Commercial Relations, IBM Corporation, Purchase, NY 10577.

The following terms, denoted by an asterisk (*) in this publication, are trademarks of the IBM Corporation in the United States and/or other countries:

IBM

Personal System/2.

IBM PS/2 2.3GB Full-High SCSI Tape HML General Checkout

1.0 General Checkout

IMPORTANT:

You have entered this pamphlet because you have a POST error code that is not listed in the system service pamphlet, or you suspect a tape drive has failed.

If more than one error code is displayed, diagnose the first error first. The cause of the first error can cause false errors to be displayed.

If there is more than one tape drive installed, refer to the Symptom-To-FRU Index in the system *Hardware Maintenance Service* pamphlet. Use the POST error code to determine which tape drive failed.

|001|

|006|

- Power-off the system and all external devices.
- Check all cables and power cords.
- Power-on all external devices.
- Install the tape drive option diskette in drive A.
- Power-on the system.
- Watch the screen for a POST error code. Press the pause key (while the code is being displayed) to hold it on the screen. Write down any error codes displayed.

DID YOU RECEIVE A 0211XXXX POST ERROR CODE?

Follow the instructions on the screen.

```
Yes No
     - |
    +---+
    002
    +---+
    Follow the instructions on the screen to run the diagnostic tests,
    then go to Step 004.
003
+---+
Go to "Symptom-to-FRU Index" in topic 3.0.
+---+
004
+---+
DID THE DIAGNOSTIC TESTS DETECT A FAILURE?
Yes No
     - |
    +---+
   |005|
    +---+
    Go to "In-Use Light Checkout" in topic 2.0.
- |
```

IBM PS/2 2.3GB Full-High SCSI Tape HML

In-Use Light Checkout

- 2.0 In-Use Light Checkout
- 1. Load a blank tape cassette (with Write Protect off) into the tape drive and close the tape-tray door.
- 2. Power-off the system.
- 3. Power-on the system and watch the tape drive In-Use Lights for the following responses:
 - a. The green and amber lights come on
 - b. The amber light goes off.

If the lights did not operate in the proper sequence, continue with "Symptom-to-FRU Index" in topic 3.0.

IBM PS/2 2.3GB Full-High SCSI Tape HML Symptom-to-FRU Index

3.0 Symptom-to-FRU Index

Error symptoms and the FRUs that might be responsible for the failure are listed below. The most-likely failing FRU is listed first. If you are unable to correct the problem using this index, go to "Undetermined Problems" in the service pamphlet for the system you are servicing.

Note: Supplemental space is available in the system ${\it Hardware\ Maintenance\ Service\ pamphlets}$ to add option error code information.

Symptom/Error	FRU/Action
0 211XX XX	Tape Drive SCSI Adapter SCSI Cable
The green light fails to come on	 Tape Drive SCSI Adapter SCSI Cable Power Cable
The amber light remains on	 Tape Drive SCSI Adapter SCSI Cable
The tape is automatically ejected from the tape drive	Tape Cassette Tape Drive SCSI Adapter SCSI Cable

IBM PS/2 2.3GB Full-High SCSI Tape HML Parts Catalog

4.0 Parts Catalog

INDEX REFERENCE NUMBERS: Refer to the illustrations for index reference
numbers listed in the left margin of the parts listing.

IBM PS/2 2.3GB Full-High SCSI Tape HML Drive Overview

5.0 Drive Overview

PICTURE 2

IBM PS/2 2.3GB Full-High SCSI Tape HML Parts

6.0 Parts

Note: Supplemental space is available in the system Hardware Maintenance Service pamphlets to add option parts information.

Index	System Unit	
1	2.3GB Tape Drive (with rails)	85F0055
2	Rail Kit	34F0041
3	Framing Bezel	64F4138
	Media Kit	59F3563
